

# Magnetic Digital Level & Angle Locator with Dot Laser Model No. 40-6065



## **Instruction Manual**

Congratulations on your choice of this Magnetic Digital Level & Angle Locator with Dot Laser. We suggest you read this instruction manual thoroughly before using the instrument. Save this instruction manual for future use.

This is a Class Illa laser tool and is manufactured to comply with CFR 21, parts 1040.10 and 1040.11 as well as international safety rule IEC 285.

©2012 Johnson Level & Tool - Rev. 2







#### **Table of Contents**

- 1. Kit Contents
- 2. Features and Functions
- 3. Safety Instructions
- 4. Location/Content of Warning Labels
- 5. Location of Parts/Components
- 6. Operating Instructions

- 7. Using the Product
- 8. Self-Check and Fine Calibration
- 9. Technical Specifications
- 10. Care and Handling
- 11. Product Warranty

#### 1. Kit Contents

<u>Description</u>	<u>Qt</u> y
"AA" Alkaline Batteries	3
Button Battery	1
Soft-sided Pouch	1
Instruction Manual	1

### 2. Features and Functions

- Displays angle and inclination simultaneously
- Angle measurements in degrees
- Angle inclination in 5 construction languages units of measure (degrees, percent, mm/m, in/ft in decimal, in/ft in fractional)
- Automatic digit inversion for overhead measurements
- Working range of angle measurement 0 to 182.5°
- Automatic shut-off
- · Hold-function to hold measurement
- · Arm can be locked in all positions
- · Visible laser beam to extend working range
- Magnetic base





## 3. Safety Instructions

Please read and understand all of the following instructions, prior to using this tool. Failure to do so, may void the warranty.

#### ATTENTION



#### **IMPORTANT**

- · Read all instructions prior to operating this laser tool. Do not remove any labels from tool.
- . Do not stare directly at the laser beam.
- . Do not project the laser beam directly into the eyes of others.
- Do not set up laser tool at eye level or operate the tool near a reflective surface as the laser beam could be projected into your eyes or into the eyes of others.
- Do not place the laser tool in a manner that may cause someone to unintentionally look into the laser beam. Serious eye injury may result.
- Do not operate the tool in explosive environments, i.e. in the presence of gases or flammable liquids.
- Keep the laser tool out of the reach of children and other untrained persons.
- . Do not attempt to view the laser beam through optical tools such as telescopes as serious eve iniury may result.
- Always turn the laser tool off when not in use or left unattended for a period of time.
- Remove the batteries when storing the tool for an extended time (more than 3 months) to avoid damage to the tool should the batteries deteriorate.
- Do not attempt to repair or disassemble the laser tool. If unqualified persons attempt to repair this tool, warranty will be void.
- Use only original Johnson® parts and accessories purchased from your Johnson® authorized dealer. Use of non-Johnson® parts and accessories will void warranty.

#### DANGER

Class Illa Laser Product Max. Power Output: ≤ 5mW Wavelength: 640-660nm

THIS TOOL EMITS LASER RADIATION. DO NOT STARE INTO BEAM. AVOID DIRECT EYE EXPOSURE.








## 4. Location/Content of Warning Labels







## 5. Location of Part/Components

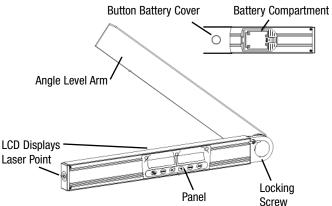






## 6. Operating Instructions

**IMPORTANT:** It is the responsibility of the user to verify the calibration of the instrument before each use.





#### **Battery Installation**

- 1. Make sure the instrument is turned off.
- Open the battery cover. Take out the old batteries and put the new batteries in paying attention to the polarity.
- 3. Power on the instrument.

**Note:** Take out the batteries if the instrument is not going to be used for a long time.

#### **Replacement of Button Battery**

- If the angle LCD displays "Erro" it is necessary to replace the button battery.
- 2. Remove the 3 screws on the button battery cover and open battery compartment.
- 3. Replace the old battery with a new battery.
- 4. Put the battery cover back on.
- 5. Check angle calibration.










## 7. Using the Product

#### **Key Guide**

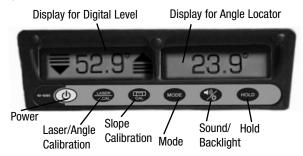

The instrument has six operating keys with their functions below:

#### **Power Key**

Power on and off the instrument by pressing this key. The instrument will beep twice when turning it on and beep once when turning it off.



#### Laser/Angle Calibration Key

Pressing this key with a short press will turn on the laser beam and the laser icon will appear on the LCD. The



instrument will also beep once. Pressing this key again with a short press will turn off the laser beam and the laser icon will disappear on the LCD. **Note:** The instrument must be turned on for the laser beam to work. Pressing this key with a long press (more then one second) will allow the unit to enter angle calibration mode. See Self-Check and Calibration section





#### **Slope Calibration Key**

The calibration key is used for re-calibrating the instrument in both the horizontal and vertical direction. Refer to Section 8 "Calibration" for details.



#### **Mode Key**

Push the MODE key to switch from one construction language to another. This controls which construction language your electronic module will measure in. Your level has the capability to measure in Degrees, Percentage of slope, Millimeters per Meter, Inches per Foot (Slope, Pitch) in decimal form and Inches per Foot in fractions of an inch. A symbol on the upper right of the screen will explain which MODE you are currently in.

#### Sound/Backlight Key


Pressing this key with a short press will turn on the sound function and the sound icon will appear on the LCD. Pressing the key again with a short press will turn off the sound function and the sound icon will disappear on the LCD. The instrument will beep once when turning the sound on and off. The level will beep faster when the level gets closer to 0° and 90° (10° - 0° and 80° - 90°) when the LCD displays 0° or 90° there will be a continuous tone. Pressing this key with a long press (more then 1 second) will turn on the backlight.

#### **Hold Key**

The angle readings change in accordance with the change of the incline. Press the key (unit will beep once) to enter into the "hold" mode. The measured angle reading will be held. The display will flash and the angle measurement will not change. Pressing the key again (unit will beep once) will stop the "hold" mode and measured value will change with the incline.







#### **Automatic Shut-off**

This instrument will shut-off automatically if no operation is received within 20 minutes.

#### Low-power Indication

The battery symbol will flash on the LCD when the battery power is low. Replace the batteries as soon as possible.



#### **Incline Indication Arrows**

The following figure shows that moving the angle level according to the indicated direction arrows is necessary if you want to position the level to horizontal or vertical.



The following figure shows that the level is level or plumb.













#### **Locking Arm**


When the surface is long, turn the angle level arm to  $180^{\circ}$ , then tighten the locking screw clockwise. You can lock the arm at any angle within the range of  $0^{\circ}$  to  $180^{\circ}$ .








The laser point will be parallel with the reference plane

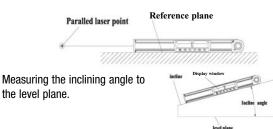

©2012 Johnson Level & Tool - Rev. 2



Measuring an angle.



#### 8. Self-Check and Fine Calibration

**IMPORTANT:** It is the responsibility of the user to verify the calibration of the instrument before each use.

To guarantee the best measuring precision of the incline, vertical and leveling plane:


Calibrate before first use.

Before important measurements.

After a hit or drop.

#### **Horizontal Calibration Check**

Put the level on a smooth level plane and observe the LCD display. Note the reading after 10 seconds. Then turn the level 180° on the same plane. After another 10 seconds note the second reading. Calibration is necessary if the difference between the two measuring readings is over 0.2°.



©2012 Johnson Level & Tool - Rev. 2








#### **Vertical Calibration Check**

Put the level on a smooth vertical plane and observe the LCD display. Note the reading after 10 seconds. Then turn the level 180° on the same plane. After another 10 seconds note the second reading. The calibration is necessary if the difference between the two measuring readings is over 0.2%.

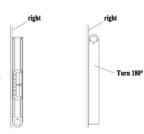

#### Calibration in the Horizontal Direction

- Put the level on a flat surface and press the "CAL" button. -0- will be displayed. Wait 10 seconds.
- Press the "CAL" button again and -1- will be displayed. Turn the level 180 degrees on the same surface. Wait another 10 seconds.
- 3. Press the "CAL" button again and -2- will be displayed. If it beeps twice the calibration is not completed and the procedure should be repeated. If it continues to beep twice the sensor may have been damaged and the unit should be serviced.

#### **Calibration in the Vertical Direction**

- Press and hold the "CAL" key for 10 seconds, unit will beep once.
   When the LCD shows -0-, it means the instrument has already entered the calibration status.
- Place the digital level on the vertical reference surface, after 10 seconds, press the "CAL" again, and the LCD shows -1-.





3. Turn the digital level 180 degrees and after 10 seconds, press the "CAL" key again, and the LCD shows -2-. Wait for 10 seconds, and the digital level will show the angle reading. The vertical calibration is now completed.

#### **Angle Calibration**

- 1. Fold the digital level and put on a smooth vertical reference point.
- 2. Press the power button and Laser/Cal button until it shows a -1-.
- 3. Unfold the digital level on the same surface.
- 4. Press the Laser/Cal button again to display -2-.
- 5. The angle calibration is completed.





## 9. Technical Specifications

 $\begin{array}{ll} \mbox{Laser Wavelength} & 650\mbox{nm} \pm 10 \\ \mbox{Laser Classification} & \mbox{Class Illa} \end{array}$ 

Maximum Power Output ≤5mW

Laser Accuracy  $\pm 1/8"/50$  ft. ( $\pm 0.2$ mm/m)

Working Range Angle  $0^{\circ}$ -182.5° Accuracy Angle  $\pm 0.1^{\circ}$  Range  $0^{\circ}$  to  $90^{\circ}$  Resolution  $0.1^{\circ}$  or 0.1%

Accuracy  $\pm 0.1^{\circ}$  for  $0^{\circ}$  and  $90^{\circ}$  and

±0.2° for 1° to 89°

Power Supply 3 "AA" alkaline batteries and

button battery

Battery Life Approx. battery life 70 hours

continuous use

Dimensions 23.6" x 2.48" x 1.57"

(600 x 63 x 40mm)

Weight 2.64 lbs (1.2kg)

Working Temperature 14°F to 113°F (-10°C to +45°C)





## 10. Care and Handling

- This laser unit is a precision tool that must be handled with care.
- Avoid exposing unit to shock vibrations and extreme temperatures.
- Before moving or transporting the unit, make sure that the unit is turned off.
- Remove the batteries when storing the unit for an extended time (more than three months) to avoid damage to the unit should the batteries deteriorate.
- Always store the unit in its case when not in use.
- · Avoid getting the unit wet.
- Keep the laser unit dry and clean, especially the laser output window. Remove any moisture or dirt with a soft, dry cloth.
- Do not use harsh chemicals, strong detergents or cleaning solvents to clean the laser unit.





## 11. Product Warranty

Johnson Level & Tool offers a one year limited warranty on each its products. You can obtain a copy of the limited warranty for a Johnson Level & Tool product by contacting Johnson Level & Tool's Customer Service Department as provided below or by visiting us online at www.johnsonlevel.com. The limited warranty for each product contains various limitations and exclusions.

**NOTE:** The user is responsible for the proper use and care of the product.

It is the responsibility of the user to verify the calibration of the instrument before each use.

For further assistance, or if you experience problems with this product that are not addressed in this instruction manual, please contact our Customer Service Department.

In the U.S., contact Johnson Level & Tool's Customer Service Department at 888-9-LEVELS.

In Canada, contact Johnson Level & Tool's Customer Service Department at 800-346-6682.



